

## Houghton-Belaire 2801 Installation Instructions

- 1) Locate White Compressor wire on the Compressor and follow to electrical box Run Capacitor “**C**” terminal. Disconnect and splice White wire connection to the Brown RVAC soft start wire.
- 2) Connect Red RVAC soft start wire to the location of the previous White Compressor wire terminal on the Run Capacitor “**C**” terminal.
- 3) **IF** you see a second Red wire next to the Red Compressor wire, disconnect it and seal end with electrical tape.
- 4) Connect Blue soft start wire to the “**H**” terminal on the Run Capacitor.
- 5) Locate the Black wire coming out of the Compressor overload switch, route and 3-way splice the final Black soft start wire to a convenient location along the Compressor’s Black wire.